Single Survey

survey report on:

Property address	15 Craigielands Park Beattock Moffat DG10 9RB

Customer	Mrs. S. Kendrick's Exec

Customer address	15 Craigielands Park Beattock Moffat DG10 9RB

Prepared by	Shepherd Chartered Surveyors

Date of inspection	12/11/2026

SHEPHERD
CHARTERED SURVEYORS

www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property[1].

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box. [X]

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

[1] Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report[2].

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

[2] Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;

- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" *is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;*

- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Single Survey

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Two storey end terraced house (ex Local Authority).

Accommodation	Ground Floor: Lounge, Kitchen and Study (former hall cupboard). First Floor: Bedroom 1, Bedroom 2, Bedroom 3 and Bathroom with w.c.

Gross internal floor area (m²)	82m² or thereby.

Neighbourhood and location	The property forms part of an established development of Local Authority type housing, close to the primary school in the village of Beattock. The garden backs onto the embankment of the main west coast railway line. The main facilities for the area are provided in the neighbouring town of Moffat.

Age	It is estimated that the property was constructed in the 1960s.

Weather	Dry and sunny.

Chimney stacks	**Visually inspected with the aid of binoculars where appropriate.** The chimney projects above the gable end of the building and is of brick roughcast construction with lead flashings, concrete coping and a capped clay pot.

Roofing including roof space	**Sloping roofs were visually inspected with the aid of binoculars where appropriate.** **Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.** **If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.** The roof is pitched and laid in profiled concrete interlocking tiles, with tiled ridging and pointed verges. Photovoltaic (PV) solar panels have been installed on the front roof pitch. Access into the attic roof space is gained through a ceiling hatch on the landing. The roof is of timber purlin frame construction overlaid with sarkingboard, and there is a felt membrane beneath the tiles. The attic is insulated above the ceilings.

Rainwater fittings	**Visually inspected with the aid of binoculars where appropriate.** The gutters and downpipes are formed in cast iron.

Main walls	**Visually inspected with the aid of binoculars where appropriate.** **Foundations and concealed parts were not exposed or inspected.** The main walls are of cavity brick construction which are roughcast externally. The walls have been drilled to install cavity insulation. Fresh air intakes on the base of the walls provide ventilation to the sub-floor areas.

Windows, external doors and joinery	**Internal and external doors were opened and closed where keys were available.** **Random windows were opened and closed where possible.** **Doors and windows were not forced open.** The windows were installed as part of a Council refurbishment of houses in the street, and are double glazed timber casements. There is timber cladding beneath the kitchen window. The front entrance has a part glazed timber panelled door, and there is a fixed double glazed screen to one side. There is a flush timber external door with double glazed top section to the kitchen.

External decorations	**Visually inspected.**

Conservatories / porches	Not applicable.

Communal areas	Not applicable.

Garages and permanent outbuildings	Not applicable.

Outside areas and boundaries	**Visually inspected.** The front garden is open plan and the irregular-shaped back garden is enclosed with timber fences. There appear to be pedestrian access rights over the subject property to the rear in favour of the occupiers of 16 Craigieland Park.

Ceilings	**Visually inspected from floor level.** The ceilings are lined with plasterboard.

Internal walls	**Visually inspected from floor level.** **Using a moisture meter, walls were randomly tested for dampness where considered appropriate.** The main walls are plastered on the hard internally and the partitions are of solid construction.

Floors including sub floors	The floors are of suspended timber construction. It was not possible to inspect the floor surfaces due to the presence of fitted coverings in all rooms. No access was gained into the sub-floor areas.

Internal joinery and kitchen fittings	**Built-in cupboards were looked into but no stored items were moved.** **Kitchen units were visually inspected excluding appliances.** The internal doors are timber panelled, and the panelled doors to the ground floor rooms are part glazed. There are fitted base and wall units in the kitchen which are on semi modern lines. A timber carpeted staircase with wall mounted handrail provides access to the first-floor landing from the hall.

Chimney breasts and fireplaces	**Visually inspected.** **No testing of the flues or fittings was carried out.** The fireplace in the lounge has been removed and the redundant chimney breast is vented.

Internal decorations	**Visually inspected.**

Cellars	Not applicable.

Electricity	**Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.** Mains electricity. The electric meter and consumer unit are in the study (former hall cupboard). The supply of electricity is supplemented by an array of photovoltaic (PV) solar panels on the front roof pitch.

Gas	No gas supply.

Water, plumbing, bathroom fittings	**Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.** **No tests whatsoever were carried out to the system or appliances.** Water is assumed to be from the mains supply. There is an insulated plastic cold water storage tank in the attic, although this may now be redundant. The kitchen units are fitted with a stainless steel sink. There is a three-piece semi modern white suite in the bathroom.


Heating and hot water	**Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.** **No tests whatsoever were carried out to the system or appliances.** A 'Mitsubishi' air source heat pump has been installed in the garden. The heat pump appears to provide domestic hot water, and it also heats radiators in the main rooms. The radiators are fitted with thermostatic valves and there is a programmer with room thermostat in the hall. The thermal store hot water tank is in a cupboard within one of the front bedrooms. Hot water is supplemented by a 'Triton' electric shower (not tested).

Drainage	**Drainage covers etc. were not lifted.** **Neither drains nor drainage systems were tested.** Drainage is assumed to be connected to the public sewer.

Fire, smoke and burglar alarms	**Visually inspected.** **No tests whatsoever were carried out to the system or appliances.** All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership. In the interests of security no comment is made in relation to the presence or otherwise of a burglar alarm.

Any additional limits to inspection	The survey was restricted by floor coverings, furniture, stored articles and personal items. Those parts of the property concealed behind fitted units and sanitary fittings etc were not viewed. No access was gained into the sub-floor areas. the roof void was inspected from the extent visible from the ceiling hatch without being fully entered. Hidden areas that were not accessed or inspected cannot be reported as being free from defect, and any comments regarding the condition of the property must be read in this context. The report does not include an Asbestos Inspection. However, asbestos was widely used in residential construction until it was finally banned 1999. If suspected asbestos containing material has been highlighted in this report, or if there are concerns of its potential existence having regard to the age of the property, a qualified asbestos surveyor should be engaged to carry out an inspection should further advice be required. The report is not a Fire Risk Assessment, and the surveyor is not qualified to provide specific advice on fire safety issues. An inspection for Japanese Knotweed was not carried out. This is a plant that is subject to control regulation, is considered invasive, and can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or on neighbouring ground. Identification of Japanese Knotweed is best undertaken by a specialist. If it exists, removal must be undertaken in a controlled manner by a specialist contractor, which can be expensive.

Sectional Diagram showing elements of a typical house

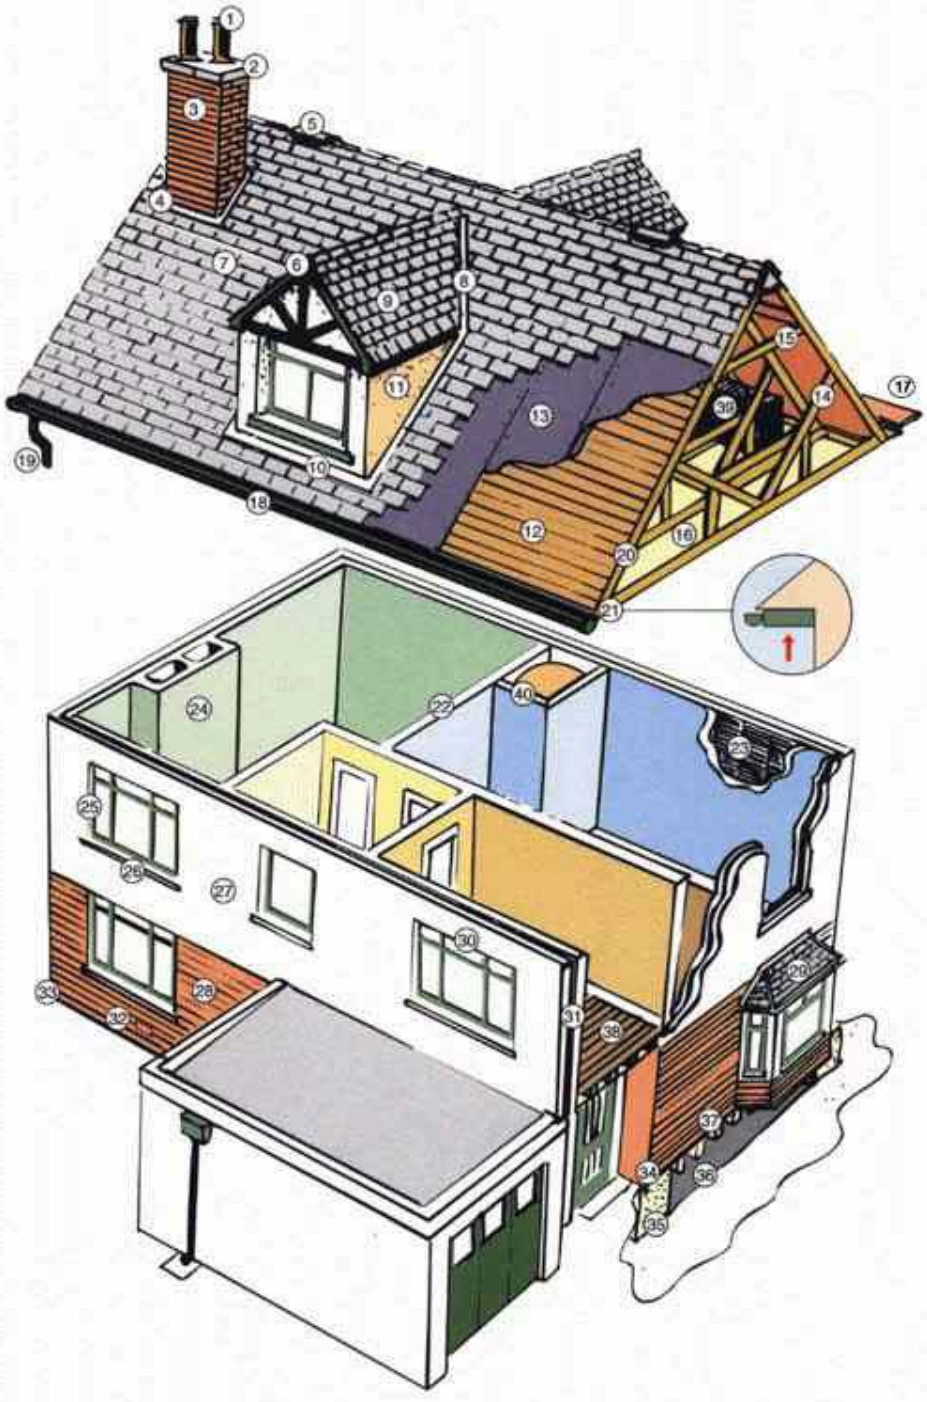

1. Chimney pots
2. Coping stone
3. Chimney head
4. Flashing
5. Ridge ventilation
6. Ridge board
7. Slates / tiles
8. Valley guttering
9. Dormer projection
10. Dormer flashing
11. Dormer cheeks
12. Sarking
13. Roof felt
14. Trusses
15. Collar
16. Insulation
17. Parapet gutter
18. Eaves guttering
19. Rainwater downpipe
20. Verge boards /skews
21. Soffit boards
22. Partition wall
23. Lath / plaster
24. Chimney breast
25. Window pointing
26. Window sills
27. Rendering
28. Brickwork / pointing
29. Bay window projection
30. Lintels
31. Cavity walls / wall ties
32. Subfloor ventilator
33. Damp proof course
34. Base course
35. Foundations
36. Solum
37. Floor joists
38. Floorboards
39. Water tank
40. Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of the inspection.

Dampness, rot and infestation	
Repair category	2
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range. Evidence of woodworm infestation was noted to the roof timbers. The floors could not be inspected due to the presence of fitted coverings. In the absence of an existing guarantee this requires to be checked by a timber specialist before purchase, and thereafter any required treatments must be undertaken to a guaranteed standard.

Chimney stacks	
Repair category	2
Notes	The chimney roughcast is weathered and has been part replaced. There is staining to the roof timbers adjoining the chimney in the attic. Chimney stacks are exposed elements of a building and are susceptible to weather-related deterioration. Regular inspections and maintenance are recommended to ensure their long-term stability and weather resistance.

Roofing including roof space	
Repair category	2
Notes	The concrete roof tiles are affected by weathering and a general degradation in condition commensurate with age. There is cracked and failed pointing to the roof verges at the gable end of the building. The roof coverings are of an age and style where ongoing maintenance expenditure should be anticipated and more extensive overhaul work or replacement may be required in the future. Roof coverings must be regularly inspected and maintained to ensure that they remain watertight. As advised, evidence of woodworm infestation was noted to the roof timbers. In the absence of an existing guarantee this requires to be checked by a timber specialist before purchase, and thereafter any required treatments must be undertaken to a guaranteed standard.

Rainwater fittings	
Repair category	2
Notes	The cast iron rainwater goods are affected by corrosion. Evidence of leakage was noted from the shared rear downpipe, with associated dampness to the adjacent roughcast wall finish. Repairs to the rainwater disposal system are required to prevent further water penetration and deterioration of the wall fabric. All rainwater fittings should be monitored during heavy rainfall to properly assess their alignment and watertightness.

Main walls	
Repair category	2
Notes	There are areas of cracked, loose and defective roughcast and render to the external walls; and some previous patch repairs are evident. There are defective concrete window sills with exposed steel reinforcement bars. As advised, the wall at the rear is wet due to a leaking downpipe. Cavity wall insulation has been installed, and it must be confirmed that a transferable insurance-backed guarantee is available.

Windows, external doors and joinery	
Repair category	2
Notes	The windows were not all fully opened or tested, but they are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units, handles and opening mechanisms, etc. Defects including failed and suspect failed double glazed units were noted, and there is decay to timber cladding beneath the kitchen window. It will be appreciated that other defects may only be evident during certain weather conditions. Consideration should be given to the replacement of the windows and doors.

External decorations	
Repair category	2
Notes	The external paintwork is weathered.

Conservatories/porches	
Repair category	N/A
Notes	Not applicable.

Communal areas	
Repair category	N/A
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	N/A
Notes	Not applicable.

Outside areas and boundaries	
Repair category	2
Notes	The fences to the back garden require repair/replacement.

Ceilings	
Repair category	1
Notes	There is hairline cracking between the joints in the plasterboard. Otherwise, within the limitations of the inspection no significant defects were noted. A textured coating (Artex® or similar) has been applied to ceilings. Older products of this type may have some asbestos content. It is generally accepted that asbestos in this form is not hazardous to health, unless it becomes damaged or disturbed. However, specialist advice must be obtained before carrying out any works of repair or removal.

Internal walls	
Repair category	1
Notes	Within the limitations of the inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no inspection of the floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The internal joinery is generally serviceable. However, wear and tear was noted to kitchen fittings etc. and future maintenance or upgrading should be anticipated.

Chimney breasts and fireplaces	
Repair category	1
Notes	The fireplace has been removed. To prevent the ingress of rainwater and to allow the circulation of air, a ventilating cap has been fitted to the top of the chimney. A ventilator has also been installed into the chimney breast, to draw air through the redundant flue and help maintain it in a dry condition.

Internal decorations	
Repair category	1
Notes	The property is in reasonable decorative order.

Cellars	
Repair category	N/A
Notes	Not applicable.

Electricity	
Repair category	2
Notes	There is no evidence of recent testing of the electrical installation. Accordingly, an Electrical Installation Condition Report (EICR) should be obtained before purchase, and any observations or recommendations should be noted as these items may require attention. The Institution of Engineering and Technology (IET) recommends that electrical installations in owner-occupied homes are professionally inspected and tested at least every 10 years and on change of occupancy. It should be appreciated that only the most recently constructed or rewired properties will have electrical installations that fully comply with IET regulations. Photovoltaic (PV) solar panels are installed at the property. It is understood that the installation may benefit from a Feed-in Tariff (FIT) arrangement, although this should be confirmed. It is assumed that the panels are owned outright and are not subject to any lease, loan, rent-a-roof scheme or other third-party finance agreement; however, this must be verified by the purchaser's legal advisers prior to purchase. The installation and associated equipment were not tested as part of the inspection and no warranty can be given regarding their condition, performance, ownership, income generation or compliance with current regulations. Appropriate documentation, including ownership details, MCS certification, warranties and any Feed-in Tariff agreements, should be obtained and examined.

Gas	
Repair category	N/A
Notes	Not applicable.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas. The cold water rising main was not fully inspectable.

Heating and hot water	
Repair category	1
Notes	Air source heating systems must be examined and serviced annually by a suitably qualified engineer, to ensure safe and efficient operation. The most recent inspection certificate dated within the past 12 months should be obtained. Any observations or recommendations made by the engineer must be noted, as these items may require attention.

Drainage	
Repair category	1
Notes	Drainage is assumed to discharge to the public sewer. The system was not tested and no warranty can be given regarding its condition or performance. The condition of underground drains can only be reliably determined by specialist CCTV inspection. No inspection chambers were opened and the below-ground drainage system was therefore not inspected.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	2
Gas	N/A
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Category 2
Repairs or replacement requiring future attention, but estimates are still advised.
Category 1
No immediate action or repair is needed.

Remember
The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning
If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability,value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:
In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:
For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	☒	No	☐
3. Is there a lift to the main entrance door of the property?	Yes	☐	No	☒
4. Are all door openings greater than 750mm?	Yes	☐	No	☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes	☐	No	☒
6. Is there a toilet on the same level as a bedroom?	Yes	☒	No	☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes	☐	No	☒
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	☐	No	☒

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

1) The assumed tenure is Absolute Ownership.

2) Only pedestrian access is available to the property.

3) The property appears to be burdened by pedestrian access rights to the rear in favour of the occupiers of 16 Craigielands Park. Details of this arrangement must be confirmed with the title deeds.

4) An opening has been formed in the wall between the former hall cupboard (now used as a study) and the kitchen. It is assumed that any required Building Warrant approval was obtained.

5) Cavity wall insulation has been installed, and it must be confirmed that a transferable insurance-backed guarantee is available.

6) Photovoltaic (PV) solar panels are installed at the property. It is understood that the installation may benefit from a Feed-in Tariff (FIT) arrangement, although this should be confirmed. It is assumed that the panels are owned outright and are not subject to any lease, loan, rent-a-roof scheme or other third-party finance agreement; however, this must be verified by the purchaser's legal advisers prior to purchase.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £270,000.

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £100,000 (ONE HUNDRED THOUSAND POUNDS STERLING).

Single Survey

Signed	*Ian Young* Electronically signed :- 14/11/2026 10:47
Report author	Ian Young
Company name	J & E Shepherd Chartered Surveyors
Address	18 Castle Street Dumfries DG1 1DR
Date of report	12/11/2026

Mortgage Valuation Report

SHEPHERD
CHARTERED SURVEYORS

www.shepherd.co.uk

Property Address

Address	15 Craigielands Park, Beattock, Moffat, DG10 9RB
Seller's Name	Mrs. S. Kendrick's Exec
Date of Inspection	12/11/2026

Property Details

Property Type
- [X] House
- [ ] Bungalow
- [ ] Purpose built maisonette
- [ ] Converted maisonette
- [ ] Purpose built flat
- [ ] Converted flat
- [ ] Tenement flat
- [ ] Flat over non-residential use
- [ ] Other (specify in General Remarks)

Property Style
- [ ] Detached
- [ ] Semi detached
- [ ] Mid terrace
- [X] End terrace
- [ ] Back to back
- [ ] High rise block
- [ ] Low rise block
- [ ] Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police? [X] Yes [ ] No

Flats/Maisonettes only Floor(s) on which located [ ] No. of floors in block [ ] Lift provided? [ ] Yes [ ] No

No. of units in block [ ]

Approximate Year of Construction 1965

Tenure

[X] Absolute Ownership [ ] Other

Accommodation

Number of Rooms
- [1] Living room(s)
- [3] Bedroom(s)
- [1] Kitchen(s)
- [1] Bathroom(s)
- [1] WC(s)
- [0] Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) 82 m² (Internal) 93 m² (External)

Residential Element (greater than 40%) [X] Yes [ ] No

Garage / Parking / Outbuildings

- [ ] Single garage
- [ ] Double garage
- [ ] Parking space
- [X] No garage / garage space / parking space

Available on site? [ ] Yes [ ] No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls	[X] Brick	[ ] Stone	[ ] Concrete	[ ] Timber frame	[ ] Other (specify in General Remarks)
Roof	[X] Tile	[ ] Slate	[ ] Asphalt	[ ] Felt	[ ] Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? [ ] Yes [X] No

If Yes, is this recent or progressive? [ ] Yes [ ] No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? [ ] Yes [X] No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and locationof the supply in General Remarks

Drainage	[X] Mains	[ ] Private	[ ] None	Water	[X] Mains	[ ] Private	[ ] None
Electricity	[X] Mains	[ ] Private	[ ] None	Gas	[ ] Mains	[ ] Private	[X] None
Central Heating	[X] Yes	[ ] Partial	[ ] None				

Brief description of Central Heating and any non mains services:

Air source heat pump to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

[ ] Rights of way [ ] Shared drives / access [ ] Garage or other amenities on separate site [ ] Shared service connections

[ ] Ill-defined boundaries [ ] Agricultural land included with property [X] Other (specify in General Remarks)

Location

[ ] Residential suburb [ ] Residential within town / city [ ] Mixed residential / commercial [ ] Shared service connections

[X] Commuter village [ ] Remote village [ ] Isolated rural property [ ] Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? [X] Yes [ ] No

If Yes provide details in General Remarks.

Roads

[ ] Made up road [ ] Unmade road [ ] Partly completed new road [X] Pedestrian access only [ ] Adopted [ ] Unadopted

Mortgage Valuation Report

General Remarks

The property forms part of an established development of Local Authority type housing, close to the primary school in the village of Beattock. The garden backs onto the embankment of the main west coast railway line. The main facilities for the area are provided in the neighbouring town of Moffat.

At the time of inspection the property was found to be maintained in reasonable condition having regard to its age and character, although fittings internally are on semi modern lines and the property would benefit from a degree of modernisation. A number of items were noted which have been reflected in the valuation figure. In general, these are mostly typical of buildings of this type and age, or are capable of remedy by routine maintenance and repair.

The property appears to be burdened by pedestrian access rights to the rear in favour of the occupiers of 16 Craigielands Park. Details of this arrangement must be confirmed with the title deeds.

An opening has been formed in the wall between the former hall cupboard (now used as a study) and the kitchen. It is assumed that any required Building Warrant approval was obtained.

Cavity wall insulation has been installed, and it must be confirmed that a transferable insurance-backed guarantee is available.

Photovoltaic (PV) solar panels are installed at the property. It is understood that the installation may benefit from a Feed-in Tariff (FIT) arrangement, although this should be confirmed. It is assumed that the panels are owned outright and are not subject to any lease, loan, rent-a-roof scheme or other third-party finance agreement; however, this must be verified by the purchaser's legal advisers prior to purchase.

Essential Repairs

None.

Estimated cost of essential repairs: N/A

Retention recommended? ☐ Yes ☒ No

Retention amount: N/A

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation

Market value in present condition: £ 100,000

Market value on completion of essential repairs: £

Insurance reinstatement value: £ 270,000

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Mortgage Valuation Report

Declaration

Signed	*Ian Young* Electronically signed :- 14/11/2026 10:47
Surveyor's name	Ian Young
Professional qualifications	MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	18 Castle Street, Dumfries, DG1 1DR
Telephone	01387 264333
Email Address	dumfries@shepherd.co.uk
Date of Inspection	12/11/2026